

TECHNICAL INFORMATION

09. April 2021

TI0521


Machine type/s:

SiLine Snack S/M

Loud operating noise

In rare cases a loud noise may occur in SiLine Snack machines during operation. This is caused by the condenser in the chiller unit having moved from its installation position. The displaced condenser causes other components to vibrate.

We recommend securing the condenser using two threaded screws M5 x 10. This prevents the condenser from moving and ensures quiet machine operation.

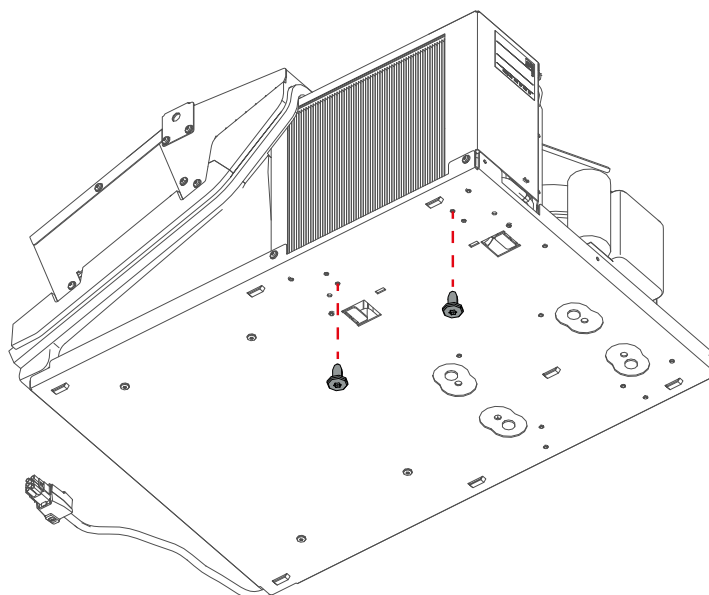

This problem has been rectified on all condensers supplied from the factory since March 2021.

Sielaff GmbH & Co. KG Automatenbau Herrieden